




*50-inch range model, dimensions may differ for other ranges

Based on Celesco's original string pot design dating back to the late 1960's, the PT101 has become a standard throughout the years for literally thousands of applications including aircraft structural testing, hydraulic cylinder control, valve stem opening, and factory automation.

Available in full stroke ranges up to 100-inches, the PT101 provides a voltage feedback signal linearly proportional to the position of its traveling stainless steel measuring cable. Additionally the PT101 installs in minutes and doesn't require perfect parallel alignment. Simply secure the base to a fixed surface and attach the measuring cable to your moving object.

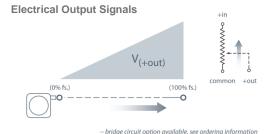

PT101

Cable Actuated Sensor Instrument Grade • Voltage Divider

Absolute Linear Position • Classic Stringpot Design Stroke Range Options: 0–2 to 0–100 inches Powder Painted & Anodized Aluminum Enclosure

General

Full Stroke Range

0-2 to 0-100 inches

Options

Output Signal Options voltage divider (potentiometer)

Accuracy $\pm 0.25\% - \pm 0.10\%$ full stroke (see ordering information)

Industrial Automation & Testing Applications

Repeatability $\pm 0.02\%$ full stroke

Resolution essentially infinite

Measuring Cable .019-inch dia. nylon-coated stainless steel rope

Enclosure Material powder-painted and anodized aluminum

Sensor plastic-hybrid precision potentiometer

Potentiometer Cycle

.ife

see ordering information

Maximum Retraction

Acceleration

see ordering information

Weight 2 lbs. max.

Electrical

Input Resistance

500, 1K, 5K, 10K or bridge

Options

Maximum Input Voltagesee ordering informationPower Ratingsee ordering informationOutput Signal Change94% ±4% of input voltage

Over Full Stroke Range

Environmental

Enclosure IP50, NEMA 1
Temperature Coefficient 88 PPM/°F

of Sensing Element


 Humidity
 100% RH @ 90°F (32° C)


 Operating Temperature
 -40° to 200°F (-40° to 90°C)

 Vibration
 up to 10 g to 2000 Hz maximum

SENSOR SOLUTIONS /// PT101 12//2015 Page 1

Fig. 1 - Top Exit

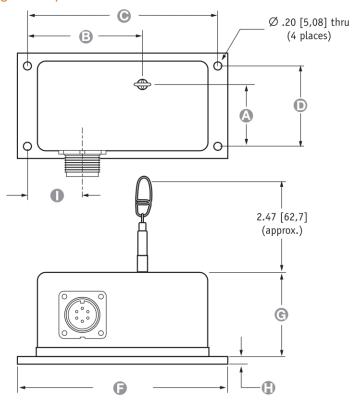

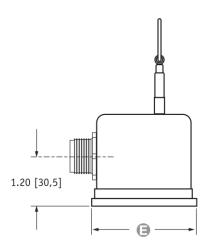


ALL DIMENSIONS ARE IN INCHES [MM] • tolerances are ±0.02 in. [±0,5mm]

Range	A	₿	•	D	3	G	G	•	0
2", 10", 20"	1.34 [34,0]	2.88 [73,1]	4.75 [120,6]	2.00 [50,8]	2.63 [66,8]	5.25 [133,4]	2.10 [53,3]	.16 [4,1]	1.37 [34,8]
5", 25", 50"	1.83 [46,5]	2.88 [73,1]	4.75 [120,6]	2.00 [50,8]	2.63 [66,8]	5.25 [133,4]	2.10 [53,3]	.16 [4,1]	1.37 [34,8]
15", 30"	1.56 [39,6]	2.88 [73,1]	4.75 [120,6]	2.00 [50,8]	2.63 [66,8]	5.25 [133,4]	2.10 [53,3]	.16 [4,1]	1.37 [34,8]
40″	1.64 [41,6]	2.88 [73,1]	4.75 [120,6]	2.00 [50,8]	2.63 [66,8]	5.25 [133,4]	2.10 [53,3]	.16 [4,1]	1.37 [34,8]
60″	2.16 [54,9]	2.88 [73,1]	6.75 [171,4]	2.37 [60,2]	3.25 [82,5]	7.50 [190,5]	2.60 [66,0]	.19 [4,8]	1.37 [34,8]
75"	2.45 [62,2]	2.38 [60,4]	6.75 [171,4]	2.50 [63,5]	3.63 [92,2]	7.50 [190,5]	2.86 [72,6]	.19 [4,8]	1.37 [34,8]
100″	3.10 [78,7]	2.47 [62,8]	7.38 [187,5]	3.00 [76,2]	4.25 [108,0]	8.00 [203,2]	3.79 [96,3]	.19 [4,8]	3.69 [93,7]

Ordering Information

Model Number:

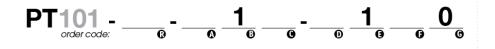

Sample Model Number:

PT101 - 0025 - 111 - 1110

range:
measuring cable tension:
cable exit:
sensing circuit:
electrical connection: 25 inches standard - 5 oz. top 500 ohms

6-pin plastic connector

Full Stroke Range:


order code:	0002	0005	0010	0015	0020	0025	0030	0040	0050	0060	0075	0100
full stroke range, min:	2 in.	5 in.	10 in.	15 in.	20 in.	25 in.	30 in.	40 in.	50 in.	60 in.	75 in.	100 in.
accuracy (% of f.s.):	0.25%		0.15%		0.10%	0.15%	0.10%					
potentiometer cycle life*:	2.5 x	106	5 x	10 ⁵	2.5 x 10 ⁵	5 x 10 ⁵	•		2.5 x	: 10 ⁵		

*-1 cycle is defined as the travel of the measuring cable from full retraction to full extension and back to full retraction


Measuring Cable Tension:


♠ order code:		1			Н				
	star	ndard tensio	on		high tension				
	tension, ±20%		max acceleration		tension, ±40%		max acceleration		
2, 10, 20 inch range:	12 oz.	•	11 g		65 oz.		53 g		
5, 25, 50 inch range:	5 oz.		2 g		26 oz.		11 g		
15, 30 inch range:	8 oz.	0	3 g		43 oz.	0	23 g		
40 inch range:	6 oz.	•	4 g		33 oz.		16 g		
60 inch range:	13 oz.	0	4 g		22 oz.	0	8 g		
75 inch range:	10 oz.	•	3 g		31 oz.		12 g		
100 inch range:	13 oz.	•	5 g	1	52 oz.		20 g		

Measuring Cable Exit:

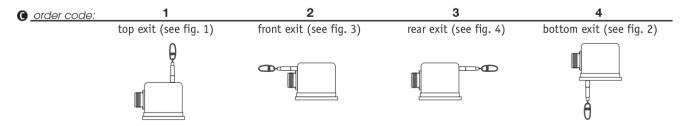


Sensing Circuit:

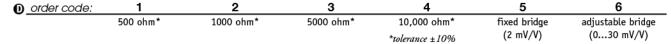


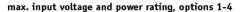




10-inch to 100-inch range 30 V AC/DC (2 W) 30 V AC/DC (2 W)

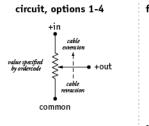

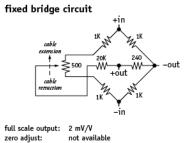

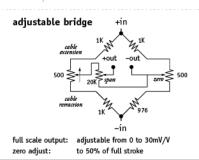


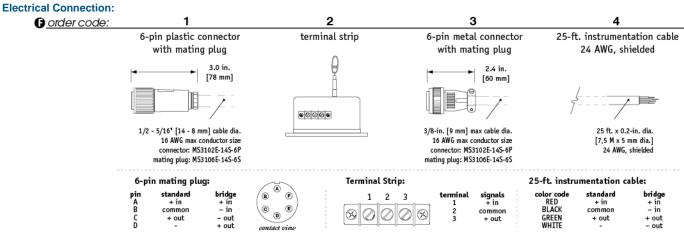



Fig. 2 - Bottom Exit

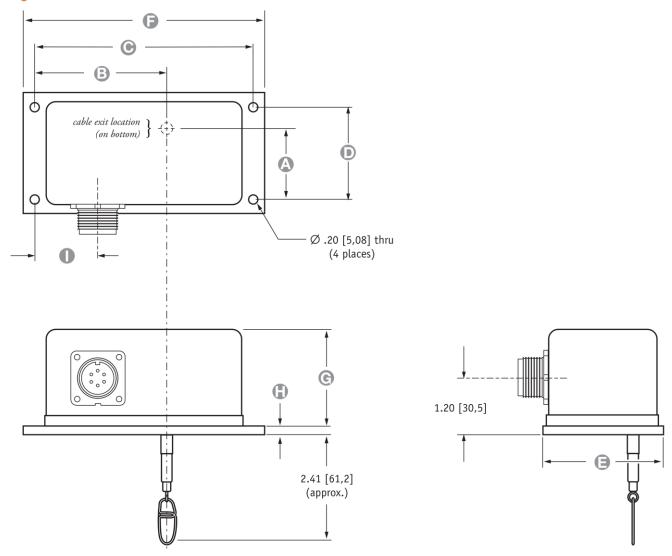

ALL DIMENSIONS ARE IN **INCHES [MM] •** tolerances are ± 0.02 in. $[\pm 0,5$ mm]

Range	A	B	©	D	ⅎ	G	e	•	0	0
2", 10", 20"	1.34[34,0]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
5", 25", 50"	1.83[46,5]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
15", 30"	1.56[39,6]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
40"	1.64[41,6]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
60"	2.16[54,9]	2.88[73,1]	6.75[171,4]	2.37[60,2]	3.25[82,5]	7.50[190,5]	2.60[66,0]	.19[4,8]	1.37[34,8]	2.63[66,8]
75"	2.45[62,2]	2.38[60,4]	6.75[171,4]	2.50[63,5]	3.63[92,2]	7.50[190,5]	2.86[72,6]	.19[4,8]	1.37[34,8]	2.69[68,3]
100"	3.10[78,7]	2.47[62,8]	7.38[187,5]	3.00[76,2]	4.25[108,0]	8.00[203,2]	3.79[96,3]	.19[4,8]	3.69[93,7]	2.90[73,7]


Fig. 3 - Rear Exit

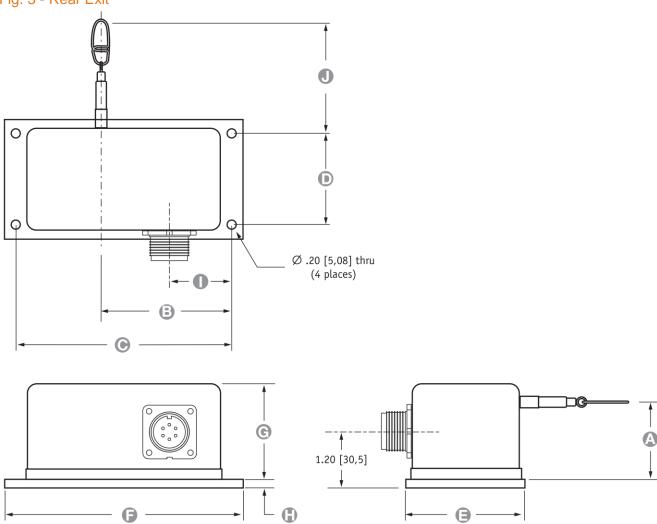

ALL DIMENSIONS ARE IN **INCHES [MM]** • tolerances are ± 0.02 in. $[\pm 0,5$ mm]

Range	A	₿	©	(D)	ⅎ	G	G	•	0	0
2", 10", 20"	1.34[34,0]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
5", 25", 50"	1.83[46,5]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
15", 30"	1.56[39,6]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
40″	1.64[41,6]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
60"	2.16[54,9]	2.88[73,1]	6.75[171,4]	2.37[60,2]	3.25[82,5]	7.50[190,5]	2.60[66,0]	.19[4,8]	5.38[136,7]	2.63[66,8]
75"	2.45[62,2]	2.38[60,4]	6.75[171,4]	2.50[63,5]	3.63[92,2]	7.50[190,5]	2.86[72,6]	.19[4,8]	5.38[136,7]	2.69[68,3]
100"	3.10[78,7]	2.47[62,8]	7.38[187,5]	3.00[76,2]	4.25[108,0]	8.00[203,2]	3.79[96,3]	.19[4,8]	3.69[93,7]	2.90[73,7]

Fig. 4 - Front Exit

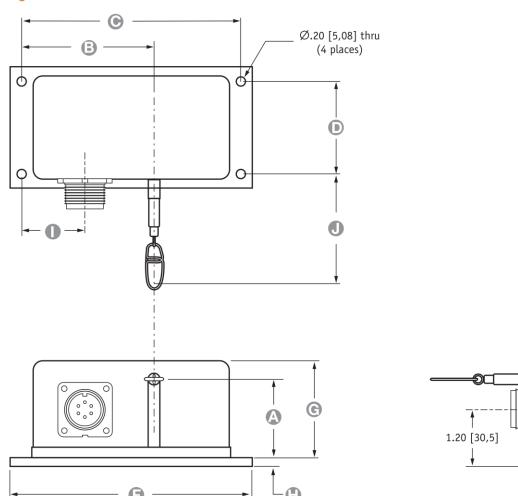

ALL DIMENSIONS ARE IN **INCHES [MM] •** tolerances are ± 0.02 in. $[\pm 0,5$ mm]

Range	A	B	©	(ⅎ	G	G	(1)	0	•
2", 10", 20"	1.34[34,0]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
5", 25", 50"	1.83[46,5]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
15", 30"	1.56[39,6]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
40"	1.64[41,6]	2.88[73,1]	4.75[120,6]	2.00[50,8]	2.63[66,8]	5.25[133,4]	2.10[53,3]	.16[4,1]	1.37[34,8]	2.57[65,3]
60"	2.16[54,9]	2.88[73,1]	6.75[171,4]	2.37[60,2]	3.25[82,5]	7.50[190,5]	2.60[66,0]	.19[4,8]	1.37[34,8]	2.63[66,8]
75"	2.45[62,2]	2.38[60,4]	6.75[171,4]	2.50[63,5]	3.63[92,2]	7.50[190,5]	2.86[72,6]	.19[4,8]	1.37[34,8]	2.69[68,3]
100"	3.10[78,7]	2.47[62,8]	7.38[187,5]	3.00[76,2]	4.25[108,0]	8.00[203,2]	3.79[96,3]	.19[4,8]	3.69[93,7]	2.90[73,7]